


CUSTOMER'S NAME	,		NOTE				I	DATE	
CUSTOMER'S PART NAME		ė							
CUSTOMER'S DRAWING NO.									
1. MECHANICAL SPECIFICA	TION				2. ELECTRI	CAL SPECIFICATION	N		
1. OUTSIDE DIMENSION	appen	d fig.				SISTANCE & TOLERANCE	terminal 1-3	1K~500K Ω± 2	20 %
2. TOTAL ROTATION ANGLE	deg	ree		300 ±5°	2. TAP RESISTA	ANCE & TOLERANCE	terminal 1-4	Ω^{\pm}	%
3. TOTAL TRAVEL STROKE	m	m		±0.5	3. RATED WAT	TAGE	temp 0~50°C	0.1	W
4. NUT WIRING STRENGTH	twisting	moment	less tha	n 7 kgf.cm	4. MAXIMUM	WORKING VOLTAGE		150	V
5. SCREW TIGHTENING FORCE	torsional	moment	less tha	n kgf.cm	5. RESISTANCE	TAPER MEASURING POINT			%point
6. ROTATION TORQUE	speed 60	deg/sec.	10~1	100 gf.cm	& TOLERANCE				25 %
7. SLIDING FORCE	speed 20	mm/sec		gf.cm	6. RESIDUAL R	RESISTANCE	terminal 1/3 side	less than 30/50	
8. SHAFT LEVER STRENGTH	pulling p	pushing	more th	nan 8 kgf.cm	7. TAP RESIDU	AL RESISTANCE	terminal 4 side	less than 100	
9. SHAFT LEVER WOBBLE	within	mm (bendir	ng momen	t gf.cm				less than 47	mV
10. SHAFT LEVER STOP STRENGTH	more than	6 kgf.cm (s	tatic load)	/ 60 sec	9. INSULATION	N RESISTANCE	more than 100	MΩ(DC 500	
		00 gf.cm / 1			10. WITHSTAND) VOLTAGE	AC 500		minute
11. TERMINAL STRENGTH	soldering heat 3			0 ±1sec	11. TRACKING ERROR			T	minute
12 CLICK POSITION & TOPOLE	resist change	-	T		12. SWITCH CO	NTACT RESISTANCE	МΩ	less than 50	$m\Omega$
12. CLICK POSITION & TORQUE gf.cm 13. SWITCH WORKING ANGLE (STROKE) degree (mm)		1000		4mm	13. SWITCH RAT	ΓING			.3A
14. SWITCH WORKING TORQUE (FORC			800	gf.cm Max				, ,	.571
15. SWITCH CIRCUIT	<u>z)</u> gr.(JIII	-	D.P.D.T	3. USABLE 7	TEMPERATURE RAN	GE: from -10°C t	o 70°C	
13. SWITCH CIRCUIT			1	D.P.D.1	4. VR LIFE	$15,000 \pm$	TIMES		
SHAFT						RESISTANCE CHAP	NGE: within ±	%	
· ·	0.7			<u> </u>		SLIDE NOISE : less t		mV	J
MATERIAL θ			NSION	- W.	SW LIFE	10,000 ±	TIMES	III V	
	at M	L	F	T	The same	CONTACT RESISTA			0
		15				CONTACT RESISTA	ince: less than	m	nΩ
MODEL NAME		DR	AWING	NO	REFE	RENCE NO.		REV	
RV16BF-10-15K-A1K-		DI	ZIVIIVO	140.					

STANDARD RESISTANCE TAPER

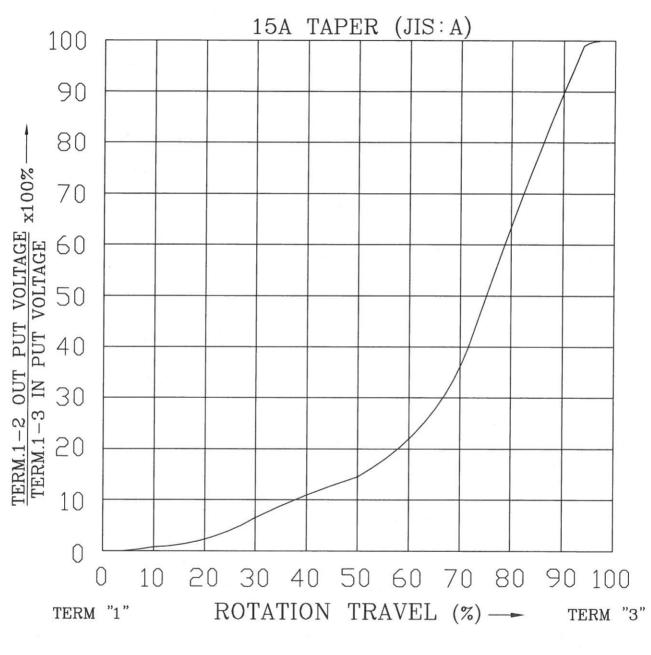

NO.	DATE		DESCRIPTIO	ON .		MODEL NAME					
TOL.	UNLESS OTHI	ERWISE STATED	DIMENSION	SCALE	DRAWN BY	CHECKED BY	APPROVED BY	DRAWING NO.			
abo abo abo	ve 30 /	10 ±0.3 ~ 30 ±0.5 ~100 ±1.0 ±5°	mm		何 90.8.21 建志	王 90.8.21 茂松	王 90.8.21 茂松				

TAIWAN ALPHA ELECTRONIC CO., LTD.

可變電阻無鉛焊錫與保管條件共通規格書

Common Specification of Lead-Free Soldering and Storage conditions for Potentiometers

以下焊錫條件以可變電阻置於單層 1.6mm 厚度之印刷電路板上測試爲基準.

The specification below is based on testing results of 1.6mm thickness single layer printed circuit board.

1. 手工焊錫條件:

For Manual Soldering:

1-1 操作溫度最高 350°C,操作時間 3 秒以內。

To be performed within 3 seconds at 350°C or below.

2. 自動或半自動機台焊錫條件:

For Automated or Semi-Automated Soldering Equipments:

2-1 使用發泡式且比重 0.82 以上的助焊劑,發泡高度以印刷電路板厚度一半為標準,且助劑不能流入可變電阻基板表面及印刷電路板表面。

Flux of 0.82 specific gravity, applied by foam fluxer, shall be used. Foam head shall be limited to the height which is half thickness of printed circuit board to be soldered. No flux should be allowed to run up onto resistive element board of potentiometer and the surface of printed circuit board.

- 2-2 預熱時間不超過兩分鐘,焊錫接面 (即印刷電路板底) 最高預熱溫度不超過 100°C。 Regarding preheating, the entire flow duration should not exceed 2 minutes, and soldering surface temperature (undersurface of PCB) shall be settled within 100°C.
- 2-3 焊錫過程機台設定溫度在 260°C 以下、 4 秒以內。
 Solder Dipping is to be performed within 4 seconds at 260°C or below.
- 3. 若回轉型電位器是塑膠軸且帶有檔位,請將主軸先調整至其中一個檔位或中心檔位上才可以 進行焊錫作業。

For rotary potentiometer with plastic shaft which have centre detent or multiple detents, the shaft should be settled in relevant detent position prior to soldering process.

4. 手工焊錫、自動或半自動機台焊錫不得超過一回。

Regardless of soldering facility and method, solder dipping or solder smearing must not be carried out more than 1 time.

註:本項焊錫溫度條件不適用於回流焊接作業設備。

Remarks: This specification is not recommended for and applicable in reflow soldering.


焊錫注意事項:

Caution for soldering:

如圖所示,請避免 PCB 上層表面有焊錫 Please avoid soldering on upper surface of P.C.B. as shown.

5. 保管條件(Storage conditions):

產品需儲存在原始的包裝,以及保持常溫 常濕、避免陽光直射、遠離任何腐蝕性氣體. 產品需盡快完全地使用完,建議最慢不要超過

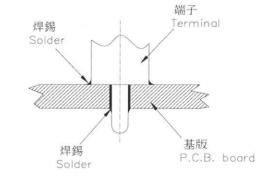

交貨後6個月.產品經拆封後,全部的數量都需迅速地使用完.

The products shall be stored in the original packaging and kept at room temperature and humidity, out of direct sunlight, and away from any and all corrosive gas. The products shall be completely used as soon as possible, but no longer than 6 months from the date of delivery. Once product packaging is opened, the complete quantity of such products shall be promptly used.